

**CITY OF BALTIMORE WET WEATHER CONSENT DECREE
SMOKE AND DYED WATER TESTING FORM**

Page 1 of 5

Sewershed: Low Level
Subsewershed: 41

Company: REI/Drayco

Date: 09/11/2008

Test Type: Smoke

Ground Condition:
Dry: ☒ Damp: ☐ Wet: ☐


Supervisor: E.R. Crew: 04

Manhole ID: S21M1_016MH

Test ID: 1029-527

Notifications Made: ☒ X
Residents, Fire, 311

Field Sketch: (Show all manholes with numbers, blower placement location, sandbag or isolation locations, street names, building addresses and locations, defect locations and photograph numbers)

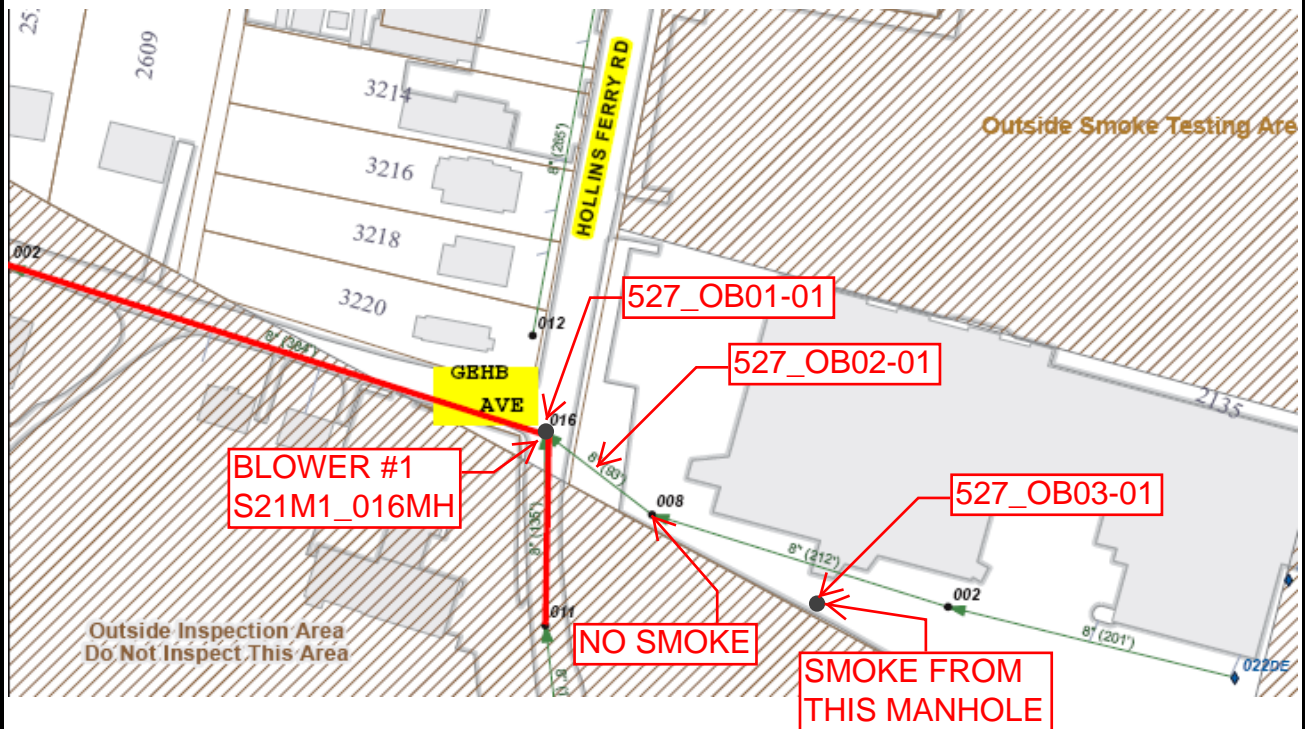

[illegible]

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
LOW LEVEL SEWERSHED
BALTIMORE CITY PROJECT 1029
REI/DRAYCO

Unique Test ID: 527	Date: 09/11/2008	Basin: LL - 41	Manhole ID: S21M1_016MH
Defect No: OB01	Supervisor: E.R.	Crew: 04	Dye Test Recommended: N
Address: S21M1_016MH			
Source Type: 01 Main Sewer		Location: 02 Asphalt	
Sector: 01 Public		Severity: 01 No Smoke	Drainage Area: 0
Comments: MANHOLE S21M1_016MH CONNECTS TO AN UNMARKED MANHOLE BEHIND SHOPPING CENTER.			

SMOKE TEST PHOTOGRAPHS



Photograph No: OB01-01
Filename: 1029-527_OB01-01.jpg

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
LOW LEVEL SEWERSHED
BALTIMORE CITY PROJECT 1029
REI/DRAYCO

Unique Test ID: 527	Date: 09/11/2008	Basin: LL - 41	Manhole ID: S21M1_016MH
Defect No: OB02	Supervisor: E.R.	Crew: 04	Dye Test Recommended: N
Address: S21M1_016MH			

Source Type: 01 Main Sewer

Location: 11 Field/Woods

Sector: 02 Private

Severity: 03 Moderate

Drainage Area: 4

Comments: SMOKE COMING FROM HOLE IN GROUND IN FRONT OF ORANGE CONE. SMOKE DID NOT COME OUT OF S21M1_016MH AS EXPECTED, BUT DID COME OUT OF UNMARKED MANHOLE AS LOCATED ON MAP.

SMOKE TEST PHOTOGRAPHS



Photograph No: OB02-01
Filename: 1029-527_OB02-01.jpg

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
LOW LEVEL SEWERSHED
BALTIMORE CITY PROJECT 1029
REI/DRAYCO

Unique Test ID: 527	Date: 09/11/2008	Basin: LL - 41	Manhole ID: S21M1_016MH
Defect No: OB03	Supervisor: E.R.	Crew: 04	Dye Test Recommended: N
Address: 2135 W. PATAPSCO AVE.			
Source Type: 01 Main Sewer		Location: 02 Asphalt	
Sector: 02 Private		Severity: 01 No Smoke	Drainage Area: 0
Comments: SMOKE WAS COMING OUT OF THIS UNIDENTIFIED MANHOLE WHEN BLOWN OUT OF S21M1_016MH.			

SMOKE TEST PHOTOGRAPHS



Photograph No: OB03-01
Filename: 1029-527_OB03-01.jpg